
Smoke and Dye Testing Summary

High Level Sewershed

Run Summary —								
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length	
S1028-254	Smoke	8/27/2009	ADS/TM	S19QQ_007MH	Dry	Yes	171.00	

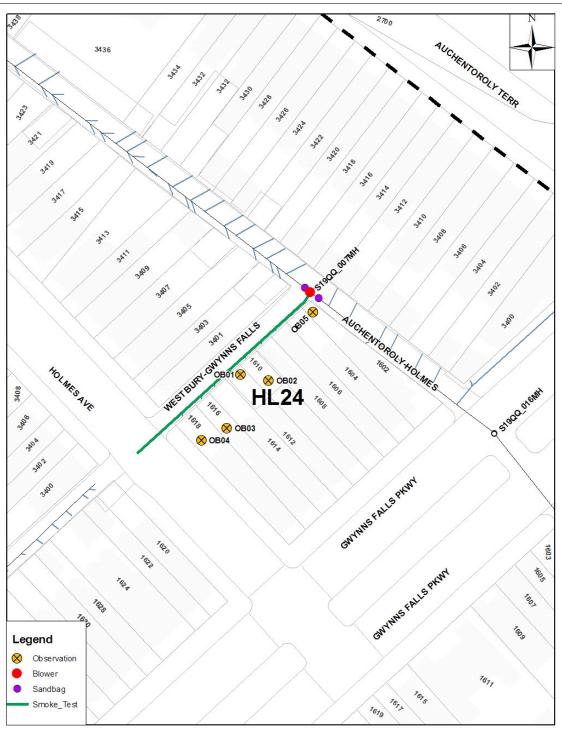

Smoke and Dye Testing Summary

High Level Sewershed

Run Summar	у						
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-254	Smoke	8/27/2009	ADS/TM	S19QQ_007MH	Dry	Yes	171.00

Isolated Pipes

Pipe ID	Upstream MH	Downstream MH	Length (ft)	Diameter (In)
S19QQ_029G1	S19QQ_029DE	S19QQ_007MH	171	8

Observations & Photos

Obs_ID S1028-254-OB01

Address 1612 Gwynns Falls Parkway

Status Private **Source** Cleanout

Location Paved concrete **Nearest MH** S19QQ_007MH

Comments Smoke from cleanout in paved concrete

behind house. 1612 Gwynns Falls Pkwy.



Picture \S1028-254-OB01-P01.jpg

Comments Back of house, 1612 Gwynns

Falls Pkwy.

Obs_ID S1028-254-OB02

Address 1610 Gwynns Falls Parkway

Status Private

Source Service Lateral

Location Paved concrete **Nearest MH** S19QQ_007MH

Comments Smoke from service lateral under paved

concrete behind house. 1610 Gwynns Falls

Pkwy.



Picture \S1028-254-OB02-P01.jpg

Comments Alley behind 1610 Gwynns Falls

Pkwy looking southwest

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary -								
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length	
S1028-254	Smoke	8/27/2009	ADS/TM	S19QQ_007MH	Dry	Yes	171.00	

Obs ID S1028-254-OB03

Address 1616 Gwynns Falls Parkway

Status Private

Source Service Lateral

Location Paved concrete **Nearest MH** S19QQ_007MH

Comments Smoke from service lateral in paved concrete

behind house. 1616 Gwynns Falls Pkwy.



Picture \S1028-254-OB03-P01.jpg

Comments Back of house, 1616 Gwynns

Falls Pkwy.

Obs_ID S1028-254-OB05

Address 1602 Gwynns Falls Parkway

Status PublicSource OtherLocation Alley

Nearest MH S19QQ_007MH

Comments Smoke from paved alley at BGE utility pole

#834659 behind house. 1602 Gwynns Falls

Pkwy.



Picture \S1028-254-OB05-P01.jpg

Comments Back of house, 1602 Gwynns

Falls Pkwy.

Obs_ID S1028-254-OB04

Address 1618 Gwynns Falls Parkway

Status Private

Source Service Lateral

Location Paved concrete **Nearest MH** S19QQ_007MH

Comments Smoke from service lateral under paved

concrete behind house. 1618 Gwynns Falls

Pkwy.



Picture \S1028-254-OB04-P01.jpg

Comments Back of lot, 1618 Gwynns Falls

Pkwy.

